

VEHICLE APPLICATION: 2007 Audi A8 Quattro Sedan (4E2) V8-4.2L

PROBLEM: Normal driving dynamics may cause microscopic movements between the wheel bearing and wheel bearing housing.

SERVICE SOLUTION

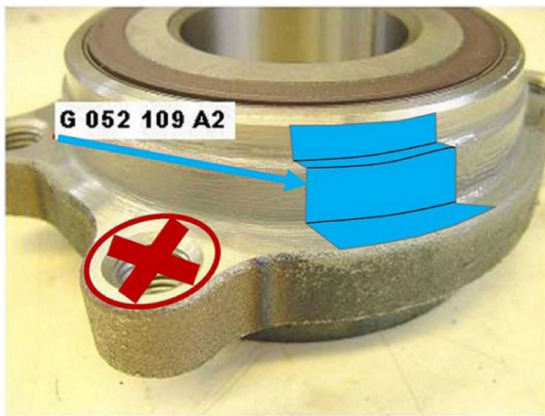


Figure 1. Area to apply paste.

1. Remove any corrosion and dirt from the wheel bearing housing and the wheel bearing.

2. Using a brush, apply a thin coat of paste G 052109A2 on the wheel bearing housing as shown in Figure 1.

Make sure not to apply any paste on the threads.

Tip: Wheel bearings replaced for this concern will not be reimbursed under warranty.

Required Parts and Tools Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.